

Mh 6A Lot 87. Adelson on East Meadows Drive. This MH has a 2 foot opening with a green plastic cover. The water at this mh was flowing lightly and was at a low level at the inlets and outlet pipes. The inlets to this MH are from 8A and 9A. The outlet is into a diversion PVC pipe to Willow Creek. A ProPipe person operated the Water Jet clearing hose into the inlets and outlets to a distance marked on the HOA's large Underdrain Map, marked in hundreds of feet. The estimated depth of this MH is 6 feet. The steel pipe is sitting on gravel on a cement foundation and ground water from the surrounding area can infiltrate. **ACTIVE.**



Mh 6A. Two foot diameter green plastic cap.



Mh 6A Pro-Pipe clean-out through to Willow Creek.



Mh 6A view of interior of steel conduit and white solid PVC outlet pipe. Inflow and outflow in direct oppositional sides. Water depth in conduit is less than six inches. April 4, 2020 inspection.



Segment A's only discharge drain; via Mh 6A outlet through solid PVC discharge pipe in easterly direction, under E. Meadows Drive, between Lot 105 & 106, into Willow Creek. This drain is the only place where the UD water reaches full Daylight.


Mh 7A on Lot 88, 4911 East Meadows Drive. Fischer. In Nov. 25, 2014 Alliance Engineering: "The Steel lid is exposed in backyard. Easy to find, at grade." Here are two photos of the large drain cover on Lot 88 near backyard patio, 2017 and 2020. Inflow via perforated tubes 6' to 10' underground, all were installed on 94 private homeowners properties.



The County has a recorded Plat Amendment on February 12, 2019 for Lots 87-88-89.



Entry 01105974 Exhibit indicates street location. Also see plat map below:

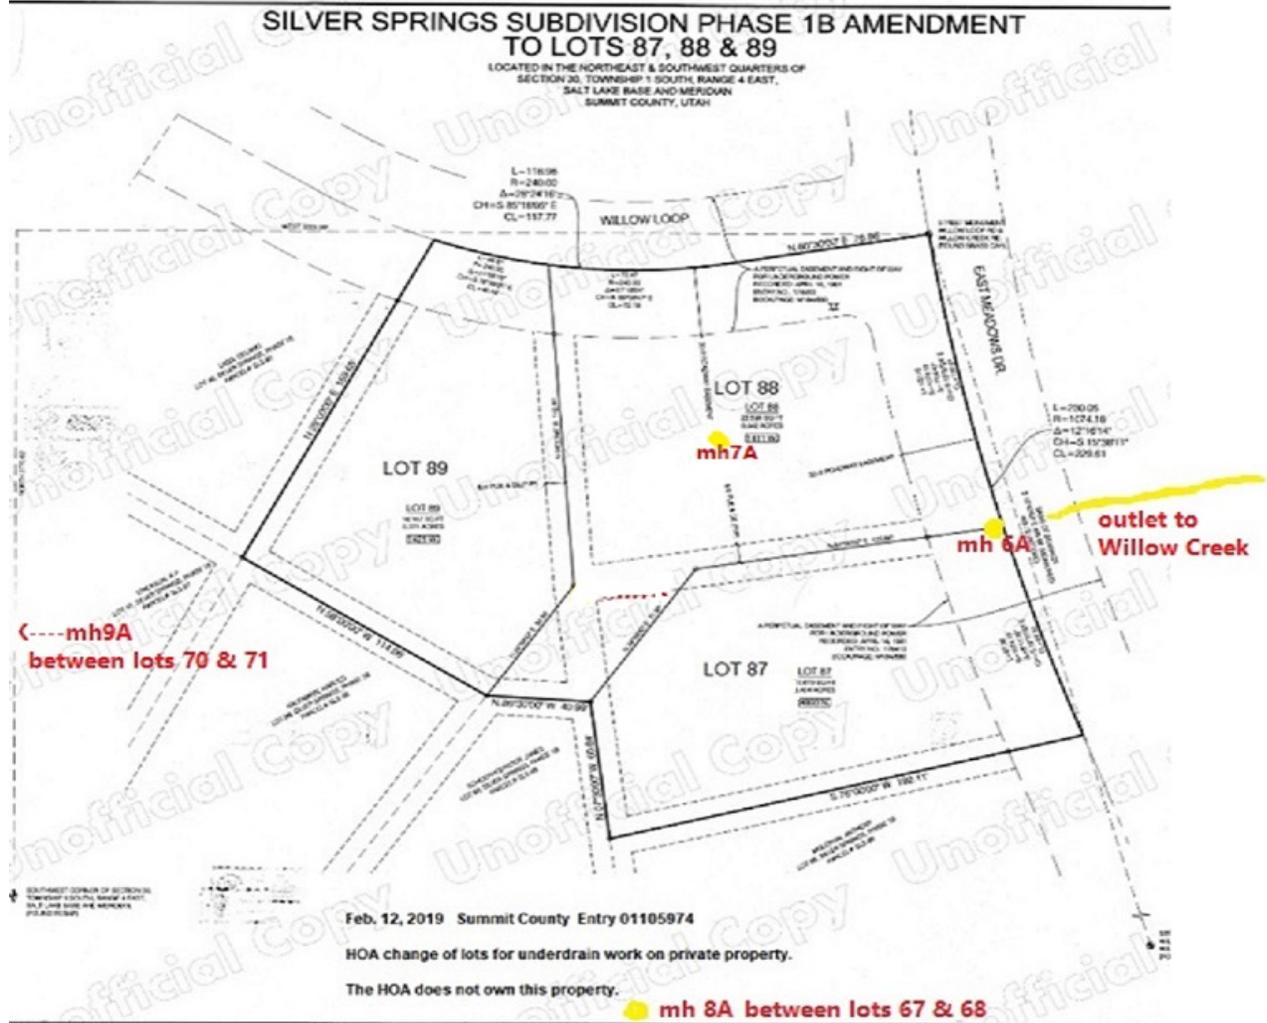

Mh 8A This Mh was added c2017 at Lot 68 Willow Loop near the curb. Lachowitz. It has a 2 foot opening with a steel cover. The water at this Mh was flowing lightly and was at a low level at the inlet and outlet pipes. The inlet to this Mh is from Mh 10A Lot 54. The outlet is into Mh 7A. The ProPipe person operated the Water Jet clearing hose into the inlet and outlet pipes in the Mh. There were a few roots coming out of the inlet pipe into the Mh 8A. There is a great deal of damage to the front yard, now covered with chipped pine bark. **ACTIVE.**



Mh 9A Lot 70. Jon Ball. On Willow Loop. Four foot lid cover and green steel conduit above grade, located 5.3 feet behind the gutter. This mh has a 4 foot opening. The water at this mh was flowing lightly and was at a low level at the inlet and outlet pipes. The inlet is from Mh 16A. Outlet is to Mh 7A, then on to Mh 6A. The ProPipe person operated the Water Jet clearing hose into the inlets and outlets pipes in the Mh. The inlet (and outlet corrugated pipes) into Mh 9A is damaged, how and why is not known. The suspect is the ProPipe jet hose and nozzle, along with the 2000 psi water jet. **ACTIVE.**



Clay measuring height of water in steel conduit.

Height of water less than 6". Damage to tubes.

Three above grade manholes are on Lot 54 (10A), Lot 70 (9A), Lot 194 (1B).